
CITY OF BALTIMORE WET W SMOKE AND DYED W	Page 1 of 5	
Sewershed: JONES FALLS	Company: REI/DRAYCO	Date: 07/16/2008
Test to be Performed: SMOKE	Ground Condition: DRY	Supervisor: ER
Manhole ID: S31UU_025MH	Test ID: 0994-378	Notifications Made:_X (Residents, Fire, 311)

Field Sketch: (Show All Manholes with Numbers, Blower Placement Location, Sandbag or Isolation Locations, Street Names, Building Addresses and Locations, Defect Locations and Photograph Numbers)

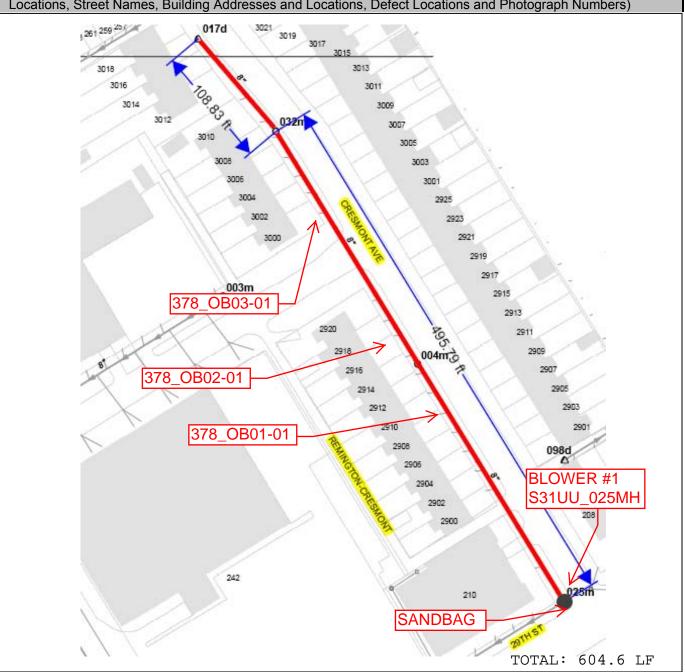

(ATHER CONSENT DECREE ER TESTING FORM				Page 2 of 5			
Sewershed: JONES FALLS			Company: REI/DRAYCO				Date: 07/16/2008		
Test to be Performed:			Ground Condition:				Supervisor:E.R		
Smoke:X Dyed Water:			Dry: _X_	Dar	mp: W	/et:			
omokeX Byed Water			BryX Bump wet				Notifications Made: X		
Manhole ID: S31UU_025MH			Test ID: 0994-378				(Residents, Fire, 311)		
Field Sketch: (Show all Manholes with Numbers, Blower Placement Location, Sandbag or Isolation Locations, Street Names, Building Addresses and Locations, Defect Locations and Photograph Numbers)									
Defect	<u>_</u>			Source Drainage					
No.	Address			Туре	Location	Sector	Area	Severity	Photo Number
1	2908 CRESMC	NT AVE.		03	07	02	10	03	378_OB01-01
2	2916 CRESMC			03	07	02	0	03	378 OB02-01
3	3000 CRESMC			03	07	02	2	03	378_OB03-01
3	3000 CRESING	MIAVE.		00	01	02		03	370_0003-01
				OBSERV	ATION	CODES			
	Source Type	Location	Sector	Severity		Source Type	Location		
01	Main Sewer	Paved Concrete	Public	No Smoke	10	MH Frame S	Non-Paved		
02	Service Line	Paved Asphalt	Private	Trace	11	Storm Drain	Field/Woods		
03	Cleanout	Paved Other		Moderate	12	Catch Basin/	Alley		
04	Downspout	Driveway		Major	13	Storm Manh	Golf Course		
05	Area Drain	Sidewalk			14	Storm Ditch	Other		
06	Driveway Drain	Curb			15	Excavation			
07	Stairwell Drain	Yard- Front			16	Other			
08	Foundation Drain	Yard-Back							
09	Building Interior	Yard- Side							

PAGE 3 OF 5

CITY OF BALTIMORE SMOKE TESTING OBSERVATION SUMMARY JONES FALLS SEWERSHED

BALTIMORE CITY PROJECT 994 REI/DRAYCO

Unique Test ID: 378 Date: 07/16/2008 Basin: JF-19

Defect No: OB01-01 Supervisor: E.R. Dye Test Recommended: N

Address: 2908 CRESTMONT AVE.

Source Type: 03 Location: 07 Severity: 03

Sector: 02 Drainage Area: 10

Comments: CLEAN OUT - BELOW GRADE UNDER STONE - NO CAP - FRONT OF HOUSE

SMOKE TEST PHOTOGRAPHS



Photograph No: OB01-01 Filename: 0994-378_OB01-01.jpg

PAGE 4 OF 5

CITY OF BALTIMORE SMOKE TESTING OBSERVATION SUMMARY JONES FALLS SEWERSHED

BALTIMORE CITY PROJECT 994 REI/DRAYCO

Unique Test ID: 378 Date: 07/16/2008 Basin: JF-19

Defect No: OB02-01 Supervisor: E.R. Dye Test Recommended: N

Address: 2916 CRESTMONT AVE.

Source Type: 03 Location: 07 Severity: 03

Sector: 02 Drainage Area: 0

Comments: CLEAN OUT - ABOVE GRADE - NO CAP - FRONT OF HOUSE

SMOKE TEST PHOTOGRAPHS



Photograph No: OB02-01 Filename: 0994-378_OB02-01.jpg

PAGE 5 OF 5

CITY OF BALTIMORE SMOKE TESTING OBSERVATION SUMMARY JONES FALLS SEWERSHED

BALTIMORE CITY PROJECT 994 REI/DRAYCO

Unique Test ID: 378 Date: 07/16/2008 Basin: JF-19

Defect No: OB03-01 Supervisor: E.R. Dye Test Recommended: N

Address: 3000 CRESTMONT AVE.

Source Type: 03 Location: 07 Severity: 03

Sector: 02 Drainage Area: 2

Comments: CLEAN OUT - AT GRADE - NO CAP - FRONT OF HOUSE

SMOKE TEST PHOTOGRAPHS



Photograph No: OB03-01 Filename: 0994-378_OB03-01.jpg